


A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19 SITUATED IN T. 16 S., R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

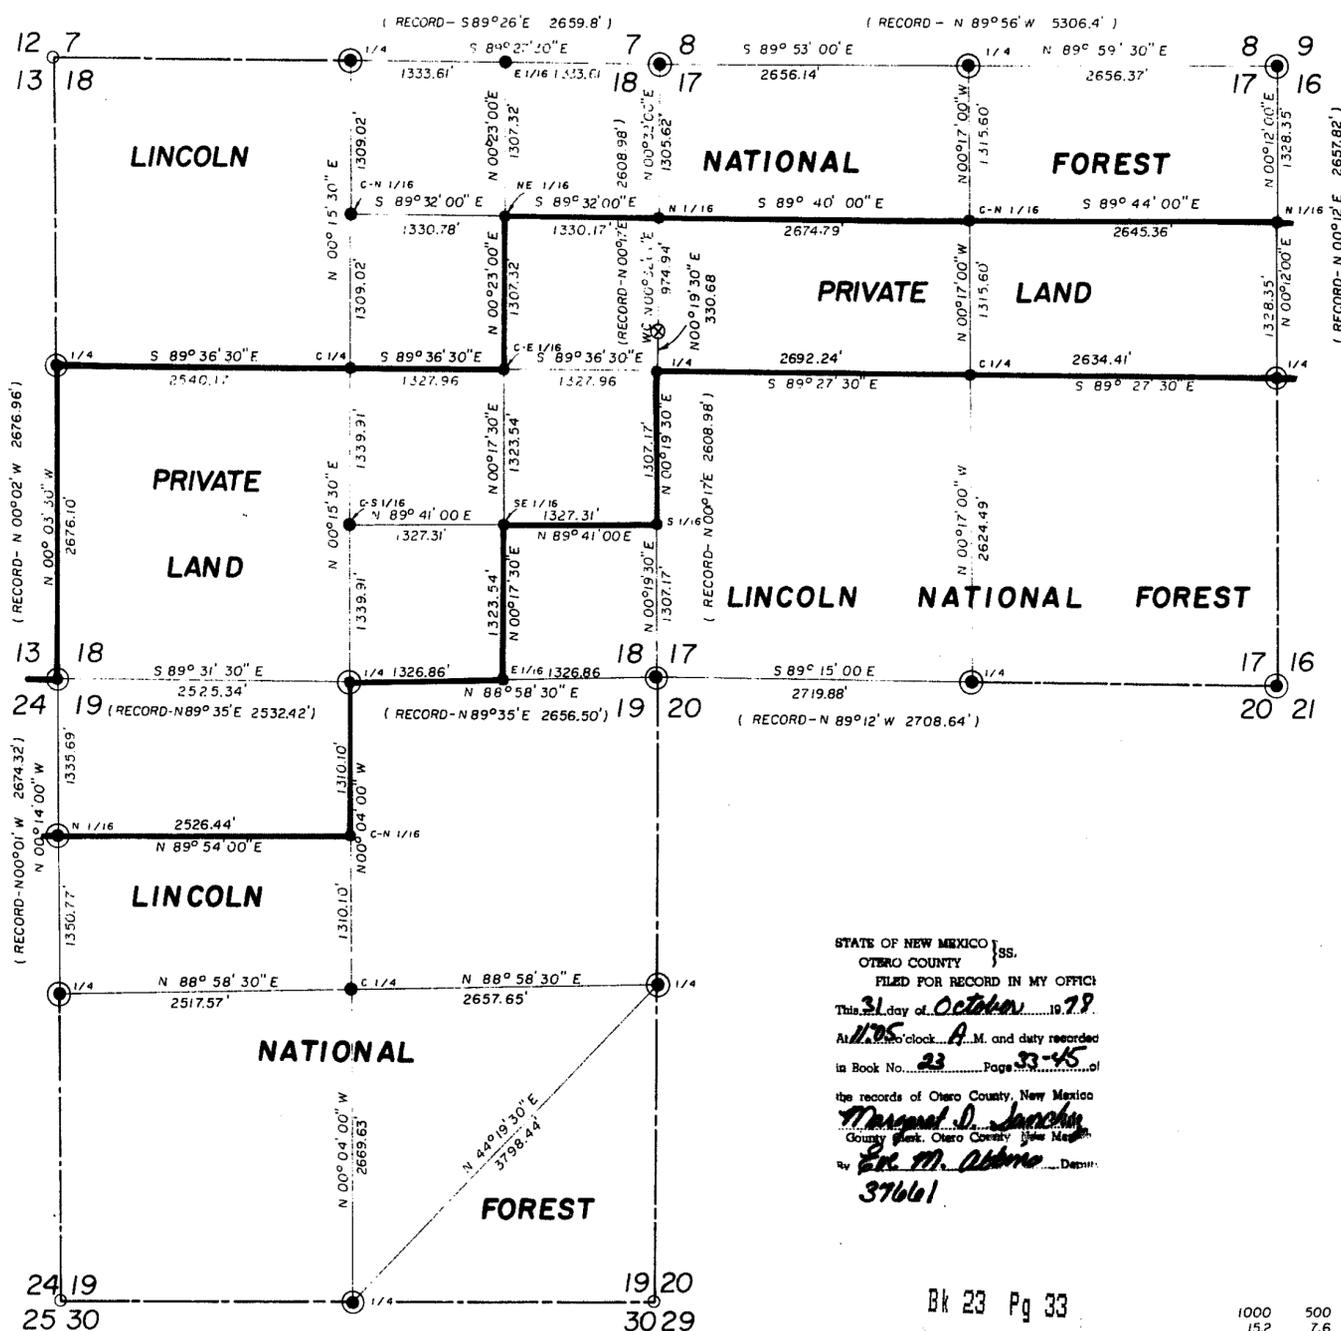

THIS PLAT CONSISTING OF 13 SHEETS REPRESENTS A RECORD OF THE RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19, TOWNSHIP 16 SOUTH, RANGE 15 EAST, NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO, WHICH CONSTITUTES A PORTION OF THE PROPERTY LINES OF THE LINCOLN NATIONAL FOREST.

A DEPENDENT RESURVEY OF THE ORIGINAL SURVEY OF T16S, R15E, WAS EXECUTED BY A. PARKER WARNER IN 1939. A DILIGENT SEARCH HAS BEEN MADE FOR ALL CORNERS ESTABLISHED AS A RESULT OF THAT SURVEY.

ALL SURVEY WORK HAS BEEN IN STRICT ACCORDANCE WITH THE "MANUAL OF INSTRUCTIONS FOR THE SURVEY OF THE PUBLIC LANDS OF THE UNITED STATES, 1973" PREPARED BY THE BUREAU OF LAND MANAGEMENT. AZIMUTH HAS BEEN DETERMINED BY SOLAR OBSERVATION. DISTANCES HAVE BEEN MEASURED ELECTRONICALLY, THE DISTANCES AND BEARINGS SHOWN ON THESE PLATS ARE A RESULT OF THIS SURVEY AND ARE ACTUAL FIELD DATA. THE DISTANCES AND BEARINGS HAVE NOT BEEN BALANCED.

THE RESURVEY, SUBDIVISION, MONUMENTATION AND RECORD THEREOF IS FOR THE PURPOSE OF IDENTIFYING AND PERPETUATING THE EVIDENCE OF THE ORIGINAL SURVEY AND FOR LOCATING THE BOUNDARIES BETWEEN LINCOLN NATIONAL FOREST AND PRIVATE OWNED LAND.

THIS RESURVEY, SUBDIVISION, MONUMENTATION AND RECORD THEREOF WAS PREPARED AS A RESULT OF THE REQUEST OF THE SUPERVISOR, LINCOLN NATIONAL FOREST. THE CONTRACT FOR THE SURVEY WITH SPECIAL INSTRUCTIONS FOR THE SURVEY IS NUMBER 53-8371-8-2572 DATED 3/31/78. THE CONTRACT WAS AWARDED TO BURKE/COLLINS/ASSOCIATES, P.C., CONSULTING ENGINEERS AND LAND SURVEYORS, ALAMOGORDO, NEW MEXICO.



LEGEND

- CORNER REMONUMENTED / MONUMENTED.....●
- FOUND G.L.O. OR B.L.M. BRASS CAP.....⊙
- FOUND EVIDENCE BELIEVED ACCEPTABLE.....⊗
- BOUNDARY OF NATIONAL FOREST LAND.....—
- PORTION OF SURVEY NOT A FOREST SERVICE PROPERTY LINE.....- - - -
- ORIGINAL SURVEY LINE NOT INCLUDED IN THIS SURVEY.....- - - -

CERTIFICATE

THIS IS TO CERTIFY THAT I AM A REGISTERED LAND SURVEYOR OF THE STATE OF NEW MEXICO, THAT THIS PLAT WAS PREPARED FROM FIELD NOTES OF ACTUAL SURVEYS MADE BY ME OR UNDER MY DIRECTION AND THAT THE SAME IS TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF.


DARRYL T. COLLINS, BURKE/COLLINS/ASSOCIATES, P.C., CONSULTING ENGINEERS & LAND SURVEYORS, ALAMOGORDO, NEW MEXICO.

Darryl T. Collins
 REGISTERED LAND SURVEYOR
 No. 4971
 NEW MEXICO
 DARRYL T. COLLINS

STATE OF NEW MEXICO } SS.
 OTERO COUNTY }
 FILED FOR RECORD IN MY OFFICE
 This 31 day of October, 1979
 At 11:05 o'clock A.M. and duly recorded
 in Book No. 23 Page 33-45 of
 the records of Otero County, New Mexico
Margaret D. Sanchez
 County Clerk, Otero County, New Mexico
 by *Eric M. Albino* Deputy
 37661

Bk 23 Pg 33

1 of 13



NOTE: BEARINGS ARE ROUNDED TO THE NEAREST 30 SECONDS.

SHEET 1 OF 13


THIRD STANDARD		PARALLEL SOUTH					
TOWNSHIP 16 SOUTH		TOWNSHIP 16 SOUTH					
2	1	6	5	4	3	2	1
11	12	7	8	9	10	11	12
	13	14	15	16	17	18	19
14	13	18	17	16	15	14	13
23	24	19	20	21	22	23	24
25	26	27	28	29	30	31	32
35	36	31	32	33	34	35	36
TOWNSHIP 16 SOUTH		TOWNSHIP 16 SOUTH					
TOWNSHIP 17 SOUTH		TOWNSHIP 17 SOUTH					
2	1	6	5	4	3	2	1

BURKE / COLLINS / ASSOCIATES, P.C.
 CONSULTING ENGINEERS
 SURVEYORS


ALAMOGORDO NEW MEXICO RUIDOSO

DRAWN BY: RSE CHECKED BY: DTC DATE: 09 / 78

A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19 SITUATED IN T. 16 S., R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

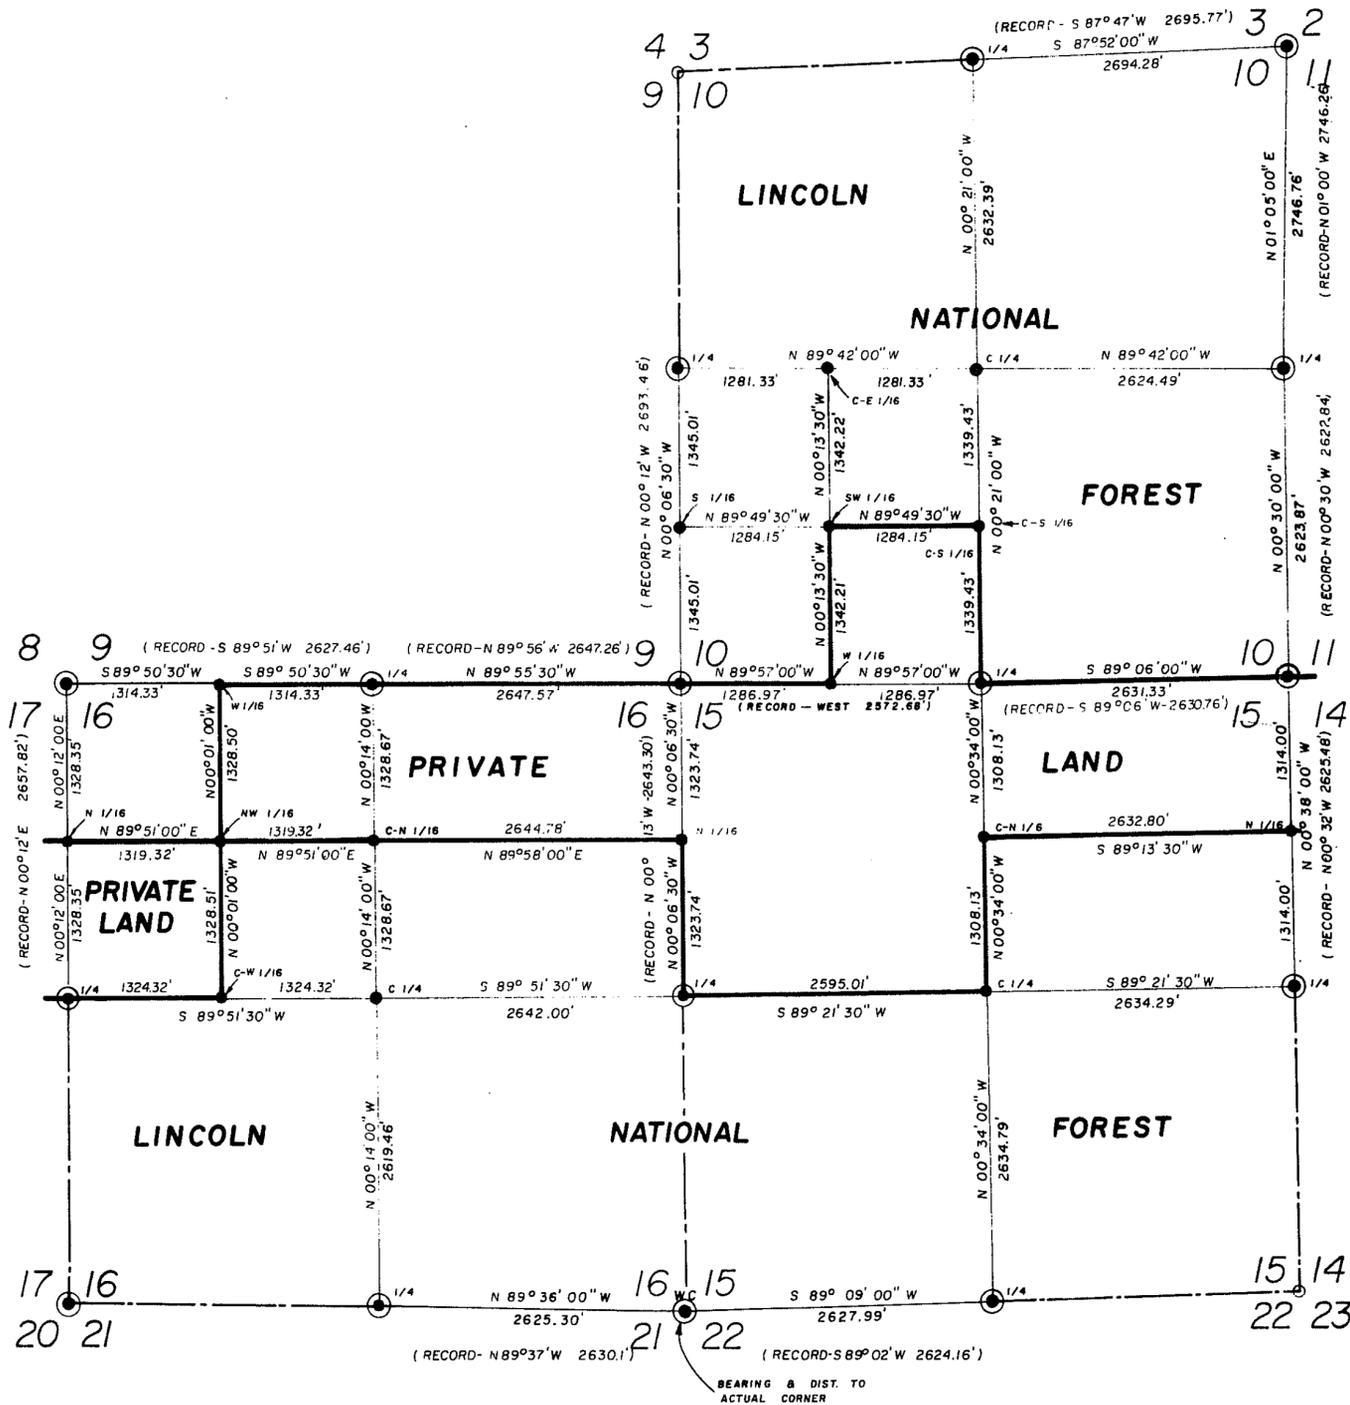

SECTIONS 10, 15 & 16



CERTIFICATE

THIS IS TO CERTIFY THAT I AM A REGISTERED LAND SURVEYOR OF THE STATE OF NEW MEXICO, THAT THIS PLAT WAS PREPARED FROM FIELD NOTES OF ACTUAL SURVEYS MADE BY ME OR UNDER MY DIRECTION AND THAT THE SAME IS TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF.

DARRYL T. COLLINS, BURKE/COLLINS/ASSOCIATES, P.C., CONSULTING ENGINEERS & LAND SURVEYORS, ALAMOGORDO, NEW MEXICO.

Darryl T. Collins



STATE OF NEW MEXICO
OTERO COUNTY
FILED FOR RECORD IN MY OFFICE
This day of October 19 78
At 11:25 o'clock P.M. and duly recorded
in Book No. 23 Page 33-45
the records of Otero County, New Mexico
Margaret A. Janda
County Clerk, Otero County, New Mexico
El M. Adams (Trust)
37661

Bk 23 Pg 34

2 of 13


SHEET 2 OF 13

BURKE / COLLINS / ASSOCIATES, P.C.
CONSULTING ENGINEERS
SURVEYORS

ALAMOGORDO NEW MEXICO RUIDOSO

DRAWN BY RSE	CHECKED BY DTC	DATE 09 / 78
-----------------	-------------------	-----------------

A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY , SUBDIVISION , AND MONUMENTATION OF SECTIONS 10 , 11 , 13 , 14 , 15 , 16 , 17 , 18 & 19 SITUATED IN T. 16 S. , R. 15 E. , NEW MEXICO PRINCIPAL MERIDIAN , NEW MEXICO

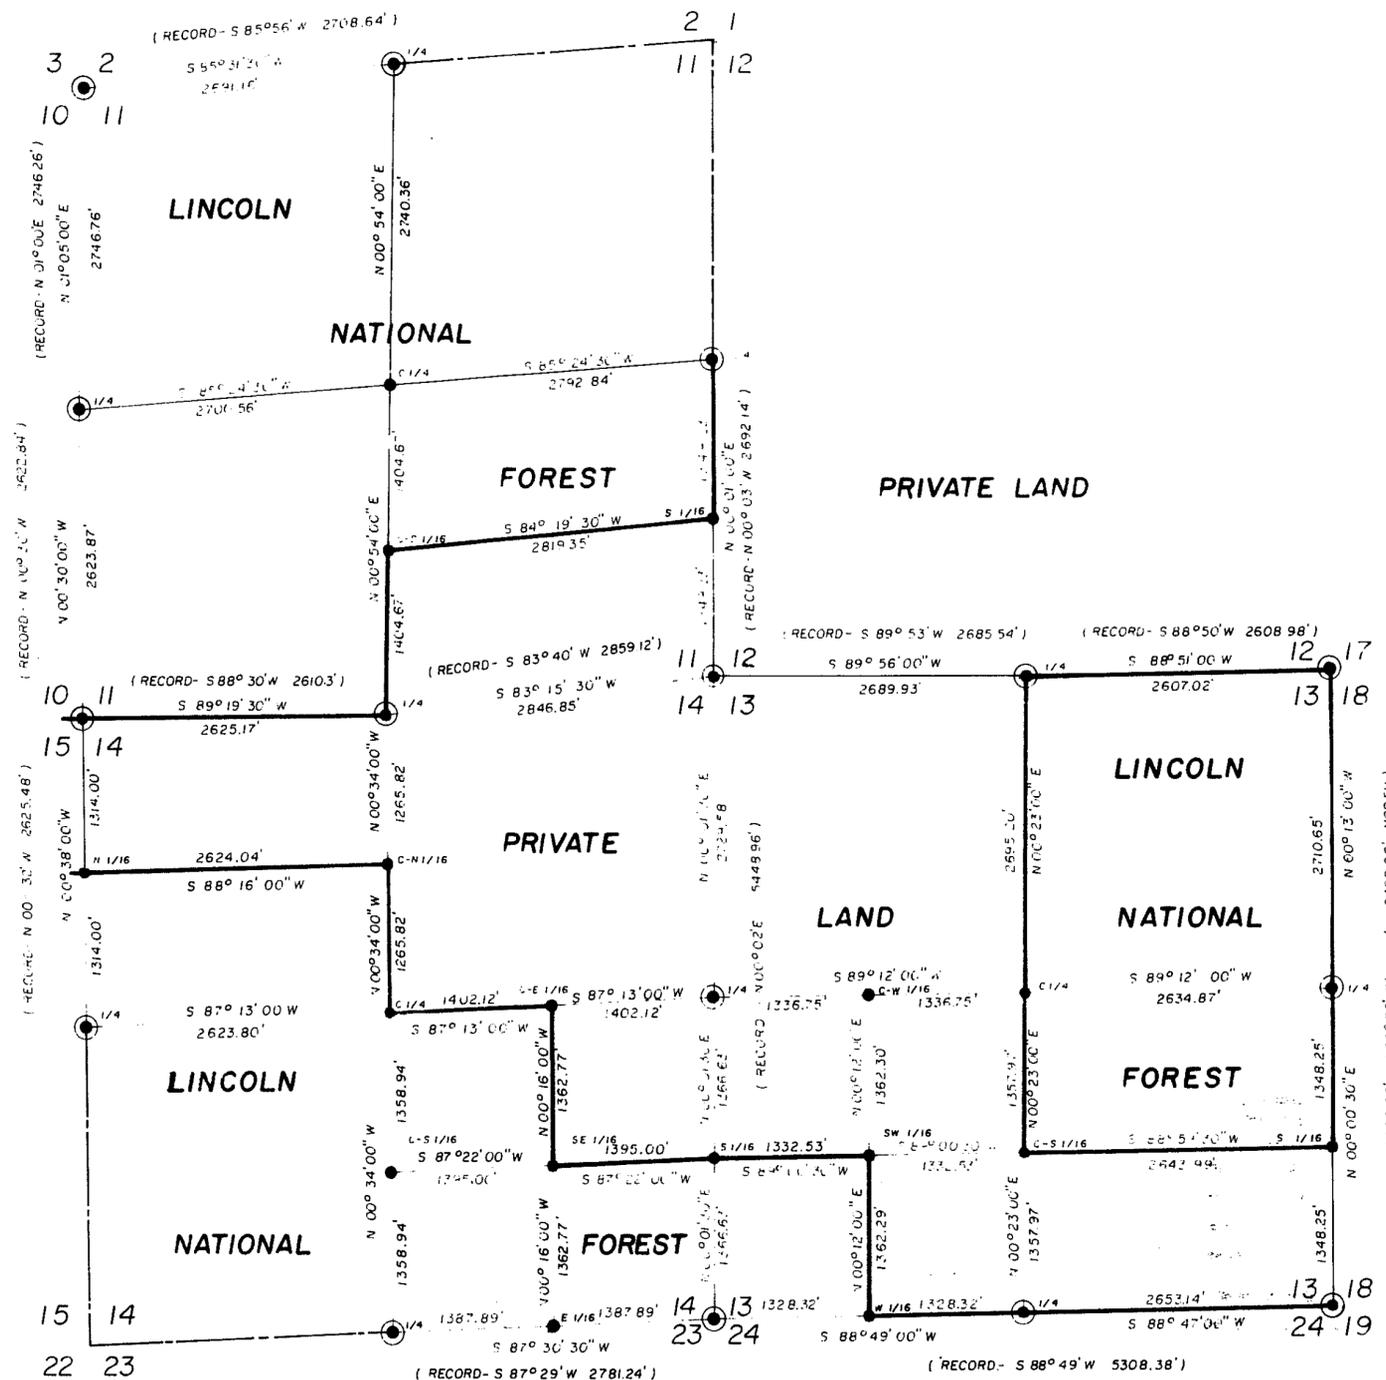

CERTIFICATE

THIS IS TO CERTIFY THAT I AM A REGISTERED LAND SURVEYOR OF THE STATE OF NEW MEXICO, THAT THIS PLAT WAS PREPARED FROM FIELD NOTES OF ACTUAL SURVEYS MADE BY ME OR UNDER MY DIRECTION AND THAT THE SAME IS TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF.

DARRYL T. COLLINS, BURKE/COLLINS/ASSOCIATES, P.C., CONSULTING ENGINEERS AND LAND SURVEYORS, ALAMOGORDO, NEW MEXICO.

Darryl T. Collins



STATE OF NEW MEXICO } SS.
 OTERO COUNTY }
 FILED FOR RECORD IN MY OFFICE
 This 31 day of October, 19 78
 At 11:05 o'clock A.M. and duly recorded
 in Book No. 23 Page 35 of
 the records of Otero County, New Mexico
Margaret A. Sanchez
 County Clerk, Otero County, New Mexico
 by *John M. Adams* Dep. Sec. 57661

SHEET 3 OF 13

BURKE/COLLINS/ASSOCIATES, PC
CONSULTING ENGINEERS
SURVEYORS

ALAMOGORDO NEW MEXICO RUIDOSO

DRAWN BY RSE	CHECKED BY DTC	DATE 09 / 78
-----------------	-------------------	-----------------

SECTIONS 11, 13 & 14

100'	500'	0	1000'	2000'	FEET
15.2	76	0	15.2	30.4	CHAINS

Bk 23 Pg 35


A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19 SITUATED IN T. 16 S., R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

SECTION 10, T16S, R15E, NMPM

FOUND CORNERS OF RECORD USED FOR THIS SURVEY. BEARING TREE DATA AS SHOWN IS AS SUPPLIED BY THE FOREST SERVICE AND HAS NOT BEEN CHECKED BY THIS SURVEYOR.

SOUTHEAST CORNER


A STANDARD GLO IRON POST PROTRUDING 36 INS. ABOVE THE GROUND, FIRMLY SET IN MOUND OF STONE, 48 X 36 INS. ABOVE THE GROUND WITH BRASS CAP MKD.

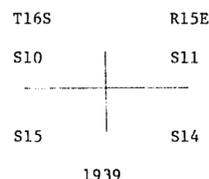

FROM WHICH
A JUNIPER 7.5 INS. IN DIAM., BEARS N 85° E, 147 LKS. DIST., MKD. T16S R15E S11 BT.
A JUNIPER, 3 INS. IN DIAM., BEARS S 66° E, 184 LKS. DIST., MKD. BT.
A JUNIPER, DEAD AND STANDING 8 INS. IN DIAM., BEARS N 74.5° W, 54 LKS. DIST., MKD.

SOUTH ONE QUARTER


A STANDARD GLO IRON POST PROTRUDING 33 INS. ABOVE THE GROUND, FIRMLY SET IN A MOUND OF STONE, 42 X 29 INS. ABOVE THE GROUND, WITH BRASS CAP MKD.

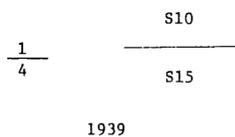

FROM WHICH
A JUNIPER, DEAD AND STANDING, 8 INS. IN DIAM., BEARS N 55.5° E, 119 LKS. DIST., MKD. 1/4 S10 BT.
A JUNIPER, 4 INS. IN DIAM., BEARS S 42° 15' W, 53 LKS. DIST. MKD. 1/4 S15 BT.

SOUTHWEST CORNER


A STANDARD GLO IRON POST, 2 INS. IN DIAM., PROTRUDING 9 INS. ABOVE THE GROUND IN A MOUND OF STONE WITH BRASS CAP MKD. ORIGINAL CORNER STONE 6 X 12 X 24 INS. ABOVE THE GROUND AND MKD. WITH 4 GROOVES SOUTH AND 3 ON EAST FACE.

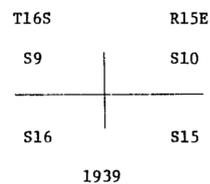

FROM WHICH
A PINON, BEARS N 30° E, 77 LKS. DIST., MKD. T16S R15E S10 BT.
A PINON, BEARS S 19° 15' E, 73 LKS. DIST., MKD. T16S R15E S15 BT.
A PINON, BEARS S 45° W, 48 LKS. DIST., MKD. T16S R15E S16 BT.
A PINON, BEARS N 61° W, 63 LKS. DIST., MKD. T16S R15E S9 BT.

WEST ONE QUARTER


A STANDARD GLO IRON POST PROTRUDING 32 INS. ABOVE THE GROUND IN A LARGE MOUND OF ROCK, 30 INS. HIGH AND 36 INS. IN DIAM WITH BRASS CAP MKD:

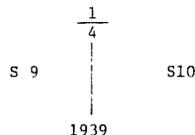

FROM WHICH
A JUNIPER, 15 INS. IN DIAM., 45 LKS. DIST., MKD. 1/4 S10 BT.
A PINON, 7 INS. IN DIAM., BEARS S 82° W, 61 LKS. DIST. DOWN AND DEAD. BLAZE COVERED WITH SAP.

NORTHWEST CORNER

A STANDARD GLO IRON POST, 2 INS. IN DIAM., PROTRUDING 27 INS. ABOVE THE GROUND, IN A MOUND OF ROCK 20 INS. ABOVE THE GROUND AND 48 INS. IN DIAM. WITH BRASS CAP MKD.

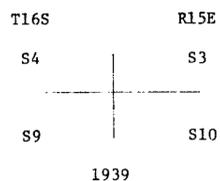

FROM WHICH
A JUNIPER, 8 INS. IN DIAM., BEARS N 62° 15' E, 105 LKS. DIST., MKD T16S R15E S3 BT. (RECORD)
A PINON, 6 INS. IN DIAM., BEARS S 31° E, 119 LKS. DIST. (DEAD & DOWN) MKD. T16 R15E S9 BT. (BT MKD. WRONG).
A PINON, 7 INS. IN DIAM., BEARS S 72° 40' W, 123 LKS. DIST. (DEAD & DOWN) MKD. T16S R15E S9 BT. (RECORD)
A PINON, 10 INS. IN DIAM., BEARS N 20° W, 86 LKS. DIST. (DEAD & DOWN) MKD. T16S R15E S4 BT. (RECORD).

NORTH ONE QUARTER


A STANDARD GLO IRON POST, 2 INS. IN DIAM., PROTRUDING 16 INS. ABOVE THE GROUND, IN MOUND OF STONE 12 INS. ABOVE THE GROUND AND 36 INS. IN DIAM. WITH BRASS CAP MKD.



FROM WHICH
A PINON, DEAD AND DOWN, 5 INS. IN DIAM., BEARS N 35° E, 54 LKS. DIST. SCRIBING NOT LEGIBLE. (RECORD).
A JUNIPER, 12 INS. IN DIAM., BEARS S 51° E, 15 LKS. DIST. MKD. 1/4 S10 BT. (RECORD).

NORTHEAST CORNER


A STANDARD GLO IRON POST, 2 INS. IN DIAM., PROTRUDING 11 INS. ABOVE THE GROUND, IN SMALL MOUND OF STONE WITH BRASS CAP.

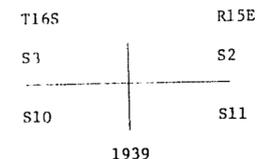

FROM WHICH
A DETERIORATED PINE BEARS N 20° 45' E, 47 LKS. DIST., MKD T16S R15E S2 BT. (RECORD).
A STUMP BEARS S 74° E, 99 LKS. DIST., NO SCRIBING VISIBLE. (RECORD).
A PINE, 22 INS. IN DIAM., BEARS S 9.5° W, 119 LKS. DIST. SCRIBING VISIBLE MKD. T16S R15E S10 BT. (RECORD).
A PINE, 18 INS. IN DIAM., BEARS N 63° 30' W, 174 LKS. DIST. MKD. T16S R15E, S3 BT. (RECORD).

EAST ONE QUARTER


A STANDARD GLO IRON POST, PROTRUDING 36 INS. ABOVE THE GROUND, FIRMLY SET IN A MOUND OF STONE 48 X 36 INS. ABOVE THE GROUND WITH BRASS CAP MKD.



FROM WHICH
BT BEARS N 53° E, 60 LKS. DIST. (RECORD) BLAZE FOUND MKD. 1/4 S11 BT.
BT BEARS S 57° W, 45 LKS. DIST. (RECORD) BLAZE FOUND MKD. 1/4 S10 BT.

CORNERS ESTABLISHED BY THIS SURVEY

W 1/16
SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 6 INS. IN THE GROUND, ENCIrcLED BY A MOUND OF STONE, 29 INS. BASE TO TOP OF ALUMINUM CAP.

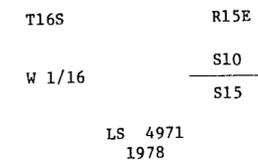

FROM WHICH
A JUNIPER (ONE SEEDED), 6 INS. IN DIAMETER, BEARS N 13-1/2° W, 106.3 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 10 INS. IN DIAMETER, BEARS N 60-3/4° W, 46 LKS. DIST., MKD. X BT.


STATE OF NEW MEXICO }
OTERO COUNTY } ss.
FILED FOR RECORD IN MY OFFICE
This day of October 1978
At 1:05 o'clock P.M. and duly recorded
in Book No. 23 Page 33-45
the records of Otero County, New Mexico.
Nancy A. Sanchez
County Clerk, Otero County, New Mexico
Lee M. Adams Deputy
37661



A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE
RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS
10, 11, 13, 14, 15, 16, 17, 18 & 19
SITUATED IN T. 16 S., R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

S 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 6 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 43 INS. BASE TO TOP OF ALUMINUM CAP.

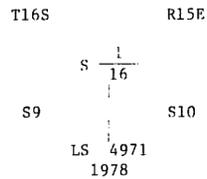


FROM WHICH
A JUNIPER (ALLIGATOR), 9 INS. IN DIAM., BEARS S 36-1/4° W, 109.2 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 13 INS. IN DIAM., BEARS S 46-1/2° E, 12.1 LKS. DIST., MKD. X BT.

FROM WHICH

A PINON, 6 INS. IN DIAM., BEARS S 20-3/4° E, 91.7 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 11 INS. IN DIAM., BEARS N 77-3/4° E, 83.8 LKS. DIST., MKD. X BT.

SW 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 1 IN. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 49 INS. BASE TO TOP OF ALUMINUM CAP.

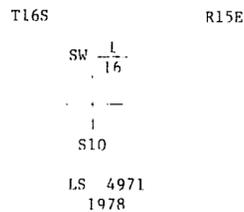

FROM WHICH

A JUNIPER (ONE SEEDED), 7 INS. IN DIAM., BEARS N 32° E, 59.1 LKS. DIST., MKD. X BT.
A FENCE POST, 8 INS. IN DIAM., BEARS N 15-1/2° W, 100.6 LKS. DIST.

SOUTHWEST CORNER

SEE SOUTHEAST CORNER SECTION 10.

WEST ONE QUARTER

SEE EAST ONE QUARTER SECTION 10.

NORTHWEST CORNER


SEE NORTH EAST CORNER SECTION 10.

NORTH ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 17 INS. ABOVE THE GROUND SURROUNDED BY A MOUND OF STONE, WITH BRASS CAP MKD.

C-S 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 3 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 53 INS. BASE TO TOP OF ALUMINUM CAP.

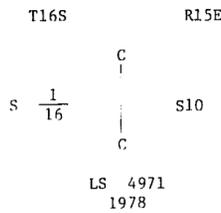


FROM WHICH
A JUNIPER (DEAD), 15 INS. IN DIAM., BEARS N 62-3/4° W, 203.5 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 18 INS. IN DIAM., BEARS N 06-1/4° W, 70 LKS. DIST., MKD. X BT.

SECTION 11, T16S, R15E, NMPM

SOUTHEAST CORNER

A STANDARD GLO IRON POST, PROTRUDING 3 INS. ABOVE A PILE OF STONE, 15 INS. ABOVE THE GROUND, WITH BRASS CAP MKD.

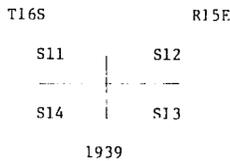


FROM WHICH

A JUNIPER, DEAD AND STANDING, 6 INS. IN DIAM., BEARS N 19° 45' E, 85 LKS. DIST. (RECORD) MKD. T16S R15E S12 BT.
A PINON, DEAD AND DOWN, 10 INS. IN DIAM., BEARS S 26° 15' E, 112 LKS. DIST. (RECORD) MARKINGS FAINT AND NOT LEGIBLE.
A PINON, DEAD AND DOWN, 4 INS. IN DIAM., BEARS S 55° W, 183 LKS. DIST., (RECORD) MKD. T16S R15E S14 BT.

NORTHEAST CORNER

A STANDARD GLO IRON POST, PROTRUDING 21 INS. ABOVE THE GROUND, FIRMLY SET IN A MOUND OF STONE, 48 INS. X 45 INS., WITH BRASS MKD.

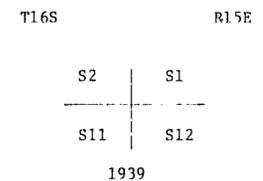


FROM WHICH

A PINON SNAG, 6 INS. IN DIAM., BEARS N 63° E, 115 LKS. DIST. SCRIBING VISIBLE NOT LEGIBLE. (RECORD).
A JUNIPER, 9 INS. IN DIAM., BEARS S 51° E, 107 LKS. DIST. MKD. T16S R15E S12 BT. (RECORD).
A JUNIPER, 8 INS. IN DIAM., BEARS S 17-1/2° W, 40 LKS. DIST. MKD. T16S R15E S11 BT. (RECORD).

C 1/4


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 8 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 41 INS. BASE TO TOP OF ALUMINUM CAP.

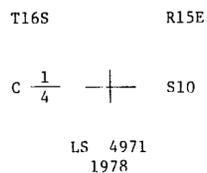

FROM WHICH
A JUNIPER (ALLIGATOR), 11 INS. IN DIAM., BEARS S 56-1/4° W, 32.8 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 6 INS. IN DIAM., BEARS S 69-3/4° E, 17.4 LKS. DIST., MKD. X BT.

SOUTH ONE QUARTER

A STANDARD GLO IRON POST, 1 INS. IN DIAM., PROTRUDING 19 INS. ABOVE THE GROUND IN A MOUND OF STONE, WITH BRASS CAP MKD.



FROM WHICH

EVIDENCE OF A PINON BEARS N 35° E, 106 LKS. DIST., MKD. 1/4 S11 BT. (RECORD).
A CEDAR STUMP, 13 INS. IN DIAM., BEARS S 15° E, 87 LKS. DIST. MKD. 1/4 S14 BT (RECORD).

STATE OF NEW MEXICO } SS.
OTERO COUNTY }
FILED FOR RECORD IN MY OFFICE
This 31 day of October 1978
At 11:05 o'clock A.M. and duly recorded
in Book No. 23 Page 33-46 of
the records of Otero County, New Mexico.
Margaret J. Sanchez
County Clerk, Otero County, New Mexico
By: D. M. Adams, Deputy
37661



SHEET 5 OF 13

BURKE / COLLINS / ASSOCIATES, PC
CONSULTING ENGINEERS
SURVEYORS


ALAMOGORDO NEW MEXICO 90500

CHECKED BY DATE
DTC 09 / 78

A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY , SUBDIVISION , AND MONUMENTATION OF SECTIONS 10 , 11 , 13 , 14 , 15 , 16 , 17 , 18 & 19 SITUATED IN T. 16 S. , R. 15 E. , NEW MEXICO PRINCIPAL MERIDIAN , NEW MEXICO

EAST ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 11 INS. ABOVE THE GROUND, FIRMLY SET WITH BRASS CAP MKD.

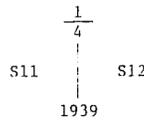


FROM WHICH
A PINON, 14 INS. IN DIAM., BEARS S 20° E (RECORD S 48° E). 78 LKS. DIST., DEAD AND DOWN, MKD. 1/4 S12 BT.
A PINON, 14 INS. IN DIAM., BEARS S 25° E 1.16 CHAINS DIST. (RECORD S 15° E, 16 LKS. DIST.) DEAD AND DOWN, MKD. 1/4 S11 BT.

CORNERS ESTABLISHED BY THIS SURVEY

S 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 5 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 48 INS. BASE TO TOP OF ALUMINUM CAP.

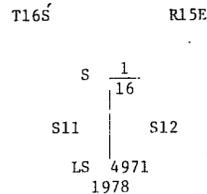

FROM WHICH
A JUNIPER (ALLIGATOR), 9 INS. IN DIAM., BEARS N 17-1/4° W, 43.9 LKS. DIST., MKD. X BT.
A FENCE POST, 9 INS. IN DIAM., BEARS N 75-1/2° W, 65.3 LKS. DIST.

C 1/4


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 8 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 39 INS. BASE TO TOP OF ALUMINUM CAP.

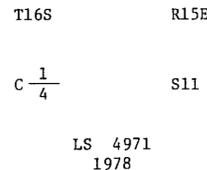

FROM WHICH
A JUNIPER (ALLIGATOR), 26 INS. IN DIAM., BEARS N 35-1/2° W, 64.1 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 29 INS. IN DIAM., BEARS N 62-1/2° E, 100.8 LKS. DIST., MKD. X BT.

C-S 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 0 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 56 INS. BASE TO TOP OF ALUMINUM CAP.

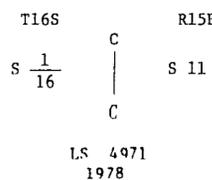


FROM WHICH

A PINON, 5 INS. IN DIAM., BEARS S 16-1/4° W, 162.5 LKS. DIST., MKD. X BT.
A FENCE POST, 6 INS. IN DIAM., BEARS S 54° E, 75.4 LKS. DIST.

SECTION 13, T16S, R15E, NMPM

SOUTHEAST CORNER

A STANDARD GLO IRON POST, PROTRUDING 10 INS. ABOVE THE GROUND, FIRMLY SET AND SURROUNDED BY A MOUND OF STONE, WITH BRASS CAP MKD.

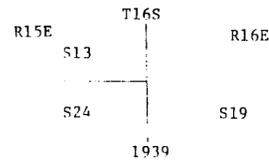


FROM WHICH

A PINON, 8 INS. IN DIAM., BEARS N 31° E, 71 LKS. DIST. BARK COVERED WITH SAP.
A PINON STUMP, 14 INS. IN DIAM., BEARS S 30° E, 50 LKS. DIST. MKD. T16S R16E S19 BT.
A JUNIPER, 6 INS. IN DIAM., BEARS S 68° W, 25 LKS. DIST. BLAZE FAINT NOT LEGIBLE.
A CEDAR, 6 INS. IN DIAM., BEARS N 60° W, 14 LKS. DIST. BLAZE FAINT NOT LEGIBLE.
HOG WIRE FENCE IS 12 INS. WEST OF CORNER AND BEARS NORTH AND SOUTH 2 CHAINS OF A ROCK BLUFF.

SOUTH ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 30 INS. ABOVE THE GROUND, LOOSELY SET IN A LARGE MOUND OF STONE, WITH BRASS CAP MKD.




FROM WHICH

A DETACHED PORTION 54 X 5 INS. BEARS N 78° 40' E, 75 LKS. DIST. MKD. 1/4 S24 BT.
A DETACHED PORTION 37 X 4 INS. BEARS S 26° 15' W, 45 LKS. DIST. MKD. 1/4 S24 BT.

SOUTHWEST CORNER

A STANDARD GLO IRON POST, PROTRUDING 24 INS. ABOVE THE GROUND, LOOSELY SET IN A LARGE MOUND OF STONE WITH BRASS CAP MKD.

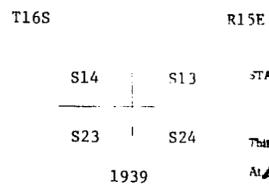

Bk 23 Pg 38

6 of 13

FROM WHICH

A CEDAR, 14 INS. IN DIAM., BEARS N 7° E, 78 LKS. DIST. (RECORD) MKD. T16S R15E S13 BT.
A DETACHED PORTION OF PINON, 32 X 5 INS. BEARS S 8° E, 58 LKS. DIST. BLAZE COVERED WITH SAP.
A JUNIPER, DOWN AND DEAD, 5 INS. IN DIAM., BEARS S 21° W, 96 LKS. DIST. (RECORD) MKD. SCRIBING VISIBLE BUT NOT LEGIBLE.

WEST ONE QUARTER

A STANDARD GLO METAL POST, PROTRUDING 24 INS. ABOVE THE GROUND, MOUNTED FIRMLY IN A STONE MOUND, WITH BRASS CAP MKD.



NO BEARING TREES ESTABLISHED.

NORTHWEST CORNER

SEE NORTHEAST CORNER SECTION 10

NORTH ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 13 INS. ABOVE THE GROUND IN A MOUND OF STONE, WITH BRASS CAP MKD.




FROM WHICH

A JUNIPER, 10 INS. IN DIAM., BEARS N 50-1/2° E, 59 LKS. DIST. (RECORD) MKD. 1/4 12 BT.
A PINON, DOWN AND DEAD, 4 INS. IN DIAM., BEARS S 31-1/2° W, 24 LKS. DIST. (RECORD) MKD. 1/4 S13 BT.

NORTHEAST CORNER

A STANDARD GLO IRON POST PROTRUDING 15 INS. ABOVE THE GROUND WITH STEEL POST ALONG SIDE.

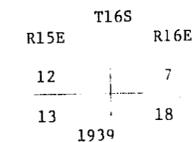

FROM WHICH

A JUNIPER, 7 INS. IN DIAM., DEAD AND STANDING, BEARS N 63° E, 30 LKS. DIST. MKD. T16S R15E S7 BT.
A JUNIPER, 9 INS. IN DIAM., BEARS S 80° E, 26 LKS. DIST. MKD. T16S R15E S18 BT.

SHEET 6 OF 13

BURKE/COLLINS/ASSOCIATES, P.C.
CONSULTING ENGINEERS
SURVEYORS

ALAMOGORDO NEW MEXICO RUIDOSO

CHECKED BY DATE
DTC 09 / 78


STATE OF NEW MEXICO } ss.
OTERO COUNTY }
FILED FOR RECORD IN MY OFFICE
This 21 day of October 19 78
At 12:06 o'clock P.M. and duly recorded
in Book No. 23 Page 33-45 of
the records of Otero County, New Mexico
Margaret D. Sanchez
County Clerk, Otero County, New Mexico
By M. Adams Deput



A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY , SUBDIVISION , AND MONUMENTATION OF SECTIONS 10 , 11 , 13 , 14 , 15 , 16 , 17 , 18 & 19 SITUATED IN T. 16 S. , R. 15 E. , NEW MEXICO PRINCIPAL MERIDIAN , NEW MEXICO

EAST ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 24 INS. ABOVE THE GROUND, FIRMLY SET IN A LARGE MOUND OF STONE, WITH BRASS CAP MKD.




FROM WHICH
A DETACHED PORTION, 22 X 36 INS. BEARS N 10° W, 30 LKS. DIST. MKD. 1/4 S13 BT.

CORNERS ESTABLISHED BY THIS SURVEY

W 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 16 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 24 INS. BASE TO TOP OF ALUMINUM CAP.

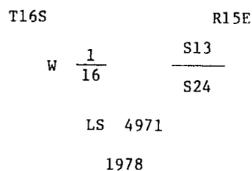

FROM WHICH
A FENCE POST, 5 INS. IN DIAM., BEARS N 7-1/4° W, 25.1 LKS. DIST.
A FENCE POST, 4 INS. IN DIAM., BEARS S 34° W, 9.9 LKS. DIST.

S 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 13 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 43 INS. BASE TO TOP OF ALUMINUM CAP.

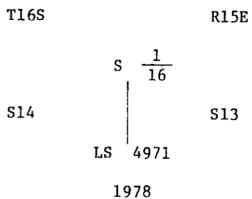

FROM WHICH
A JUNIPER (ALLIGATOR), 8 INS. IN DIAM., BEARS N 87-1/2° W, 28.9 LKS. DIST., MKD. X BT.
A JUNIPER (ONE SEEDED), 7 INS. IN DIAM., BEARS S 49-1/2° E, 18.3 LKS. DIST., MKD. X BT.

S 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 14 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 41 INS. BASE TO TOP OF ALUMINUM CAP.

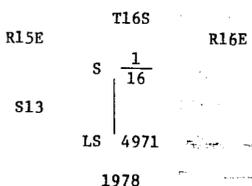


FROM WHICH

A JUNIPER (ALLIGATOR), 14 INS. IN DIAM., BEARS S 05-1/2° E, 92 LKS. DIST. MKD. X BT.
A JUNIPER (ALLIGATOR), 8 INS. IN DIAM., BEARS N 86-1/2° E, 132.6 LKS. DIST., MKD. X BT.

C 1/4

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 13 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 43 INS. BASE TO TOP OF ALUMINUM CAP.

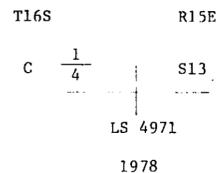


FROM WHICH

A JUNIPER (ALLIGATOR), ALIVE, USED AS FENCE POST, 8 INS. IN DIAM., BEARS N 52-1/2° W, 75.8 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 11 INS. IN DIAM., BEARS S 65-1/2° W, 46.2 LKS. DIST., MKD. X BT.

C-S 1/16

SET A 4 INS. BRASS CAP IN A 9 INS. SQUARE CONCRETE MONUMENT PROTRUDING 2 INS. ABOVE THE GROUND, 2 FEET NORTH OF THE EDGE OF A 12-FOOT HIGH VERTICAL CLIFF AND 30 FEET NORTH OF THE CENTERLINE OF U.S. 82 WITH BRASS CAP.

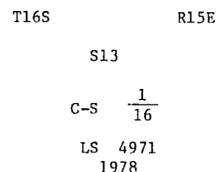


FROM WHICH

THE WEST TERMINUS OF A BARBED WIRE R/W FENCE BEARS N 83-1/2° E, 47 LKS. DIST.
NO SUITABLE BEARING TREES AVAILABLE.

C-W 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 6 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 43 INS. BASE TO TOP OF ALUMINUM CAP.

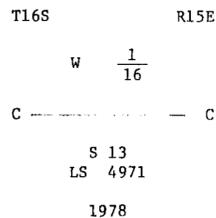


FROM WHICH

A PINON, 5 INS. IN DIAM., BEARS N 13-3/4° E, 46.6 LKS. DIST., MKD. X BT.
A FENCE POST, 7 INS. IN DIAM., BEARS S 67-1/4° W, 44.7 LKS. DIST.

SW 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 12 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 41 INS. BASE TO TOP OF ALUMINUM CAP.

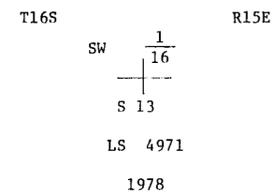

A JUNIPER (ONE SEEDED), 7 INS. IN DIAM., BEARS S 78-1/2° W, 64.1 LKS. DIST. MKD. X BT.
A JUNIPER (ONE SEEDED), 7 INS. IN DIAM., BEARS S 19-3/4° W, 18.7 LKS. DIST., MKD. X BT.


SECTION 14, T16S, R15E, NMPM

SOUTHEAST CORNER

SEE SOUTHWEST CORNER OF SECTION 13.

SOUTH ONE QUARTER

A STANDARD GLO IRON POST, 1 IN. IN DIAM., PROTRUDING 24 INS. ABOVE THE GROUND AND A MOUND OF STONE, 24 INS. HIGH 36 INS. IN DIAM., AROUND CORNER WITH BRASS CAP MKD.

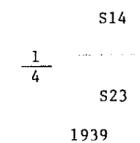


FROM WHICH

A DEAD AND DOWN PINON, 12 INS. IN DIAM., BEARS N 38-1/4° E, 72 LKS. DIST. (RECORD) MKD. 1/4 S14 BT.
A JUNIPER, 15 INS. IN DIAM., BEARS S 73° W, 51 LKS. DIST. (RECORD) MKD. 1/4 S23 BT.

SOUTHWEST CORNER

A STANDARD GLO IRON POST, PROTRUDING 19 INS. ABOVE GROUND IN A MOUND OF STONE WITH BRASS CAP MKD.

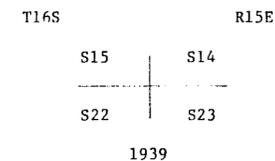

STATE OF NEW MEXICO } ss.
OTERO COUNTY }
FILED FOR RECORD IN MY OFFICE
This day of October 1978
At 11:20 o'clock A. M. and duly recorded
in Book No. 23 Page 33-45
the records of Otero County, New Mexico
County Clerk, Otero County, New Mexico
By M. Allen Deputy



SHEET 7 OF 13

BURKE/COLLINS / ASSOCIATES, P.C.
CONSULTING ENGINEERS
SURVEYORS

ALAMOGORDO **NEW MEXICO** RUIDOSO


CHECKED BY DATE
DTC 09/78

A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19 SITUATED IN T. 16 S., R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

FROM WHICH A DEAD AND STANDING PINON, 8 INS. IN DIAM., BEARS N 80° 45' E, 65 LKS. DIST. (RECORD). MKD. T16S R15E S14 BT. A DEAD AND DOWN PINON, 5 INS. IN DIAM., BEARS S 5° E, 64 LKS. DIST. (RECORD) MKD. T16S R15E S23 BT. A JUNIPER, DEAD AND STANDING, 5 INS. IN DIAM., BEARS S 31° W, 46 LKS. DIST. (RECORD) T16S R15E S22 BT.

WEST ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 12 INS. ABOVE THE GROUND, IN A MOUND OF STONE WITH BRASS CAP MKD.



FROM WHICH AT N 82-1/2° E, 46 LKS. DIST. (RECORD) FOUND DETERIORATED PINON BLAZE NOT VISIBLE. AT N 64° W, 30 LKS. DIST. (RECORD) FOUND PORTION OF A PINON DEAD AND DOWN, NO SCRIBING VISIBLE.

NORTHWEST CORNER

SEE SOUTHEAST CORNER OF SECTION 10.

NORTH ONE QUARTER

SEE SOUTH ONE QUARTER OF SECTION 11.

NORTHEAST CORNER

SEE SOUTHEAST CORNER OF SECTION 11.


EAST ONE QUARTER

SEE WEST ONE QUARTER OF SECTION 13.

CORNERS ESTABLISHED BY THIS SURVEY

E 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 14 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 48 INS. BASE TO TOP OF ALUMINUM CAP.

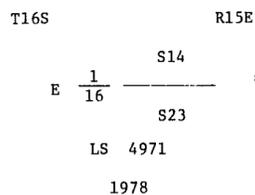


STATE OF NEW MEXICO } ss. OTERO COUNTY FILED FOR RECORD IN MY OFFICE This 31 day of October 19 78 At 11:05 A.M. and duly recorded in Book No 23 Page 39-46 of the records of Otero County, New Mexico. Margaret D. Sanchez County Clerk, Otero County, New Mexico. J. M. Adams Deputy 37661

FROM WHICH A JUNIPER (ALLIGATOR), 15 INS. IN DIAM., BEARS S 36-1/4° E, 67.2 LKS. DIST. MKD. X BT. A JUNIPER (ALLIGATOR), 20 INS. IN DIAM., BEARS S 54-3/4° W, 78.3 LKS. DIST. MKD. X BT.

N 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 12 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 29 INS. BASE TO TOP OF ALUMINUM CAP.

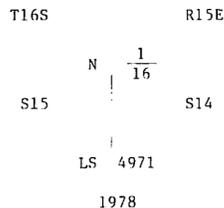

FROM WHICH A JUNIPER (ALLIGATOR), 7 INS. IN DIAM., BEARS S 73-1/4° E, 53.7 LKS. DIST., MKD. X BT. A JUNIPER (ALLIGATOR), 9 INS. IN DIAM., BEARS S 54° W, 23 LKS. DIST., MKD. X BT.

C-S 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 11 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 48 INS. BASE TO TOP OF ALUMINUM CAP.

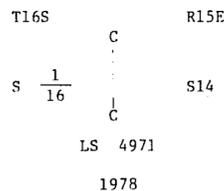

FROM WHICH A JUNIPER (ALLIGATOR), 19 INS. IN DIAM., BEARS N 10-3/4° W, 81.6 LKS. DIST., MKD. X BT. A JUNIPER (ONE SEEDED), 8 INS. IN DIAM., BEARS N 81-1/4° E, 67.6 LKS. DIST., MKD. X BT.

C 1/4


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 7 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 36 INS. BASE TO TOP OF ALUMINUM CAP.

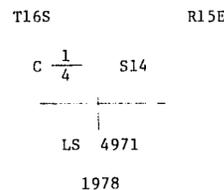

FROM WHICH A PINON, 7 INS. IN DIAM., BEARS S 34-1/4° E, 113 LKS. DIST., MKD. X BT. A JUNIPER (ALLIGATOR), 8 INS. IN DIAM., BEARS S 71-3/4° W, 112.1 LKS. DIST., MKD. X BT.

C-N 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 25 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 17 INS. BASE TO TOP OF ALUMINUM CAP.

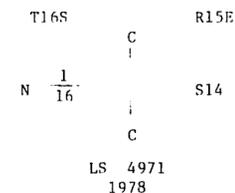

FROM WHICH A JUNIPER (ALLIGATOR), 11 INS. IN DIAM., BEARS S 55-1/2° W, 140.4 LKS. DIST., MKD. X BT. A JUNIPER (ONE SEEDED), 8 INS. IN DIAM., BEARS S 2-3/4° W, 208.1 LKS. DIST., MKD. X BT.

C-E 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 9 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 43 INS. BASE TO TOP OF ALUMINUM CAP.

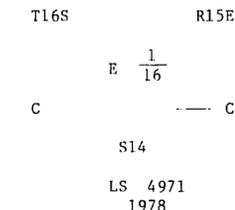

FROM WHICH A JUNIPER (ALLIGATOR), 17 INS. IN DIAM., BEARS S 31-1/4° W, 124.2 LKS. DIST., MKD. X BT. A JUNIPER (ALLIGATOR), 11 INS. IN DIAM., BEARS N 47-3/4° W, 48.7 LKS. DIST., MKD. X BT.

SE 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 1 IN. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 44 INS. BASE TO TOP OF ALUMINUM CAP.

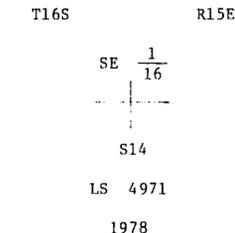

FROM WHICH A JUNIPER (ONE SEEDED), 18 INS. IN DIAM., BEARS N 13-3/4° W, 63.9 LKS. DIST. MKD. X BT. A JUNIPER (ONE SEEDED), 9 INS. IN DIAM., BEARS S 78-1/2° W, 112 LKS. DIST., MKD. X BT.



BURKE / COLLINS / ASSOCIATES, P.C. CONSULTING ENGINEERS SURVEYORS ALAMOGORDO NEW MEXICO RUIDOSO CHECKED BY DATE DTC 09 / 78

A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY , SUBDIVISION , AND MONUMENTATION OF SECTIONS 10 , 11 , 13 , 14 , 15 , 16 , 17 , 18 & 19 SITUATED IN T. 16 S. , R. 15 E. , NEW MEXICO PRINCIPAL MERIDIAN , NEW MEXICO

SECTION 15, T16S, R15E, NMPM

NORTHWEST CORNER

C-N 1/16

SEE SOUTHWEST CORNER OF SECTION 10.

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 21 INS. IN THE GROUND, ENCRICLED BY A MOUND OF STONE, 26 INS. BASE TO TOP OF ALUMINUM CAP.

SOUTHEAST CORNER

SEE SOUTHWEST CORNER OF SECTION 14.

NORTH ONE QUARTER


SEE SOUTH ONE QUARTER OF SECTION 10.

NORTHEAST CORNER

SEE NORTHWEST CORNER OF SECTION 14.

EAST ONE QUARTER

SEE WEST ONE QUARTER OF SECTION 14.

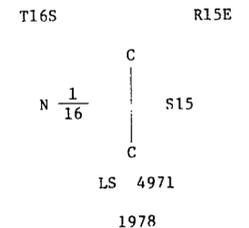

FROM WHICH
A JUNIPER (ONE SEEDED), 17 INS. IN DIAM., BEARS S 17-3/4° E, 74.6 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 7 INS. IN DIAM., BEARS S 84-3/4° E, 147.6 LKS. DIST., MKD. X BT.


SECTION 16, T16S, R15E, NMPM

SOUTHEAST CORNER

SEE SOUTHWEST CORNER OF SECTION 15.

SOUTH ONE QUARTER


A STANDARD GLO IRON POST PROTRUDING 26 INS. ABOVE THE GROUND, WITH BRASS CAP MKD. ORIGINAL CORNER ALONGSIDE 19 X 11 X 5 WITH 1/4 ON NORTH FACE.

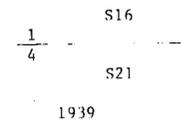

FROM WHICH
A DETACHED PORTION OF PINON, 23 X 3 INS. BEARS S 45° 15' W, 36 LKS. DIST. MKD. 1/4 S21 BT. (RECORD).
A DETACHED PORTION OF PINON, 20 X 4 INS. BEARS N 43-1/2° W, 76 LKS. DIST. (RECORD 84 LKS) MKD. 1/4 S16 BT.

SOUTHWEST CORNER


A STANDARD GLO IRON POST, PROTRUDING 14 INS. ABOVE THE GROUND IN A MOUND OF STONE WITH BRASS CAP MKD.

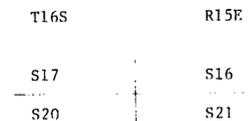

FROM WHICH
A JUNIPER (ALLIGATOR), 18 INS. IN DIAM., BEARS N 33-3/4° E, 28.4 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 18 INS. IN DIAM., BEARS S 26-1/2° E, 11.5 LKS. DIST., MKD. X BT.

SOUTHWEST CORNER

A STANDARD GLO IRON POST, PROTRUDING 12 INS. ABOVE THE GROUND, FIRMLY SET, WITH BRASS CAP MKD:

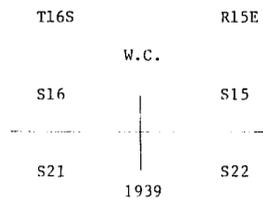


FROM WHICH
A PINE, 11 INS. IN DIAM., BEARS N 24° 45' E, 57 LKS. DIST. (RECORD) BLAZE CLOSED.
A PINE STUMP, 14 INS. IN DIAM., BEARS S 36° E, 168 LKS. DIST., (RECORD) MKD. 22 WC BT.
A PINE, DOWN AND DEAD, 18 INS. IN DIAM., BEARS S 76° W, 45 LKS. DIST. (RECORD) MKD. 6S R15E S21 BT.

CORNERS ESTABLISHED BY THIS SURVEY

N 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 16 INS. IN THE GROUND, ENCRICLED BY A MOUND OF STONE, 24 INS. BASE TO TOP OF ALUMINUM CAP.

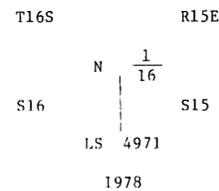

FROM WHICH
A JUNIPER (ONE SEEDED), 30 INS. IN DIAM., BEARS S 89-1/4° W, 52 LKS. DIST., MKD. X BT.
A JUNIPER (ONE SEEDED), 27 INS. IN DIAM., BEARS S 8-3/4° W, 135.6 LKS. DIST., MKD. X BT.


C 1/4

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 4 INS. IN THE GROUND, ENCRICLED BY A MOUND OF STONE, 41 INS. BASE TO TOP OF ALUMINUM CAP.

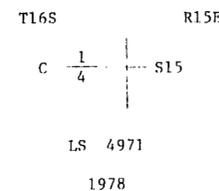

WEST ONE QUARTER

A STANDARD GLO IRON POST, LOOSELY SET IN A LARGE MOUND OF STONE, 36 X 24 INS. HIGH. MKD. BRASS CAP PROTRUDES 36 INS. ABOVE GROUND.

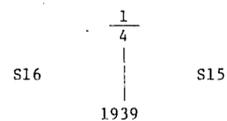

FROM WHICH
A JUNIPER, DEAD AND STANDING, 9 INS. IN DIAM., BEARS S 52-1/2° E, 90 LKS. DIST. MKD. 1/4 S15 BT. (RECORD).
A DETACHED PORTION, 26 X 5 INS. BEARS N 31° 45' W, 82 LKS. DIST., MKD. 1/4 S16 BT. (RECORD).

STATE OF NEW MEXICO } ss.
OTERO COUNTY }
FILED FOR RECORD IN MY OFFICE
This 31 day of October 1978
At _____ o'clock _____ A.M. and duly recorded
in Book No. 23 Page 33-45 of
the records of Otero County, New Mexico
Margaret D. Sanchez
County Clerk, Otero County, New Mexico
By _____ Deputy



A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY , SUBDIVISION , AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19 SITUATED IN T. 16 S. , R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN , NEW MEXICO

FROM WHICH
A PINON, DEAD AND DOWN, 16 INS. IN DIAM., BEARS N 59° E, 161 LKS. DIST., (RECORD) NO MARKINGS VISIBLE.
DETACHED PORTION OF PINON, 36 X 3 INS., BEARS S 56° E, 102 LKS. DIST. (RECORD) MKD. T16S R15E S20 BT.
A CEDAR, 6 INS. IN DIAM., BEARS S 30° W, 80 LKS. DIST. (RECORD) MKD. T16S R15E S20 BT.


NORTHEAST CORNER
SEE SOUTHWEST CORNER OF SECTION 10.

FROM WHICH
A JUNIPER (ALLIGATOR), 5 INS. IN DIAM., BEARS N 08-1/2° W, 48.7 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 7 INS. IN DIAM., BEARS N 72-1/2° W, 44.8 LKS. DIST., MKD. X BT.

WEST ONE QUARTER
A STANDARD GLO IRON POST, PROTRUDING 10 INS. ABOVE THE GROUND WITH BRASS CAP MKD.


EAST ONE QUARTER
SEE WEST ONE QUARTER OF SECTION 15.

C-N 1/16
SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 2 INS. IN THE GROUND, ENCIrcLED BY A MOUND OF STONE, 42 INS. BASE TO TOP OF ALUMINUM CAP.




CORNERS ESTABLISHED BY THIS SURVEY

N 1/16
SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 4 INS. IN THE GROUND, ENCIrcLED BY A MOUND OF STONE, 43 INS. BASE TO TOP OF ALUMINUM CAP.

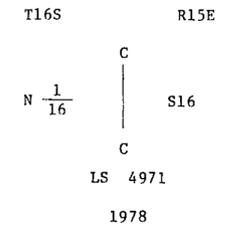

FROM WHICH
A JUNIPER, 8 INS. IN DIAM., BEARS S 82° E, 96 LKS. DIST., (RECORD) BLAZE CLOSED.
A CEDAR, 8 INS. IN DIAM., BEARS S 15° W, 91 LKS. DIST. (RECORD STATES BEARING S 58° 15' W).

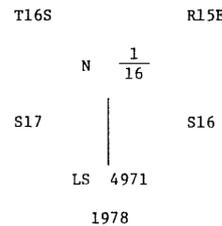


FROM WHICH
A JUNIPER (ALLIGATOR), 25 INS. IN DIAM., BEARS S 37-1/2° W, 48.4 LKS. DIST. MKD. X BT.
A JUNIPER (ALLIGATOR), 15 INS. IN DIAM., BEARS S 64° E, 35.5 LKS. DIST., MKD. X BT.


NORTHWEST CORNER
A STANDARD GLO IRON POST, 2 INS. IN DIAM., PROTRUDING 17 INS. ABOVE THE GROUND, SURROUNDED BY A MOUND OF STONE, WITH BRASS CAP MKD:

FROM WHICH
A JUNIPER (ONE SEEDED), 10 INS. IN DIAM., BEARS N 56-1/2° E, 106.3 LKS. DIST., MKD. X BT.
A JUNIPER (ONE SEEDED), 11 INS. IN DIAM., BEARS N 04-3/4° W, 102 LKS. DIST. MKD. X BT.


C-W 1/16
SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 3 INS. IN THE GROUND, ENCIrcLED BY A MOUND OF STONE, 48 INS. BASE TO TOP OF ALUMINUM CAP.

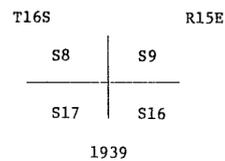

W 1/16
SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 18 INS. IN THE GROUND, ENCIrcLED BY A MOUND OF STONE, 29 INS. BASE TO TOP OF ALUMINUM CAP.

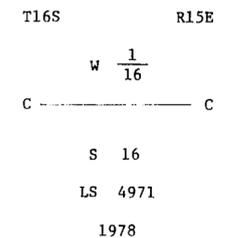

FROM WHICH
A JUNIPER, 23 INS. IN DIAM., BEARS N 36° E, 90 LKS. DIST. (RECORD) MKD. T16S R15E S9 BT.
EVIDENCE OF BEARING IN S.E. DIRECTION, 10 LKS. DIST., MKD. T16S R15E S16 BT.
A DETERIORATED PINON, 8 INS. IN DIAM., BEARS N 65° W, 61 LKS. DIST., (RECORD) MKD. T16S R15E S8 BT.


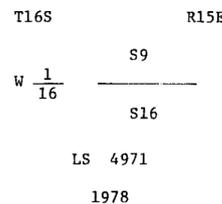


FROM WHICH
A JUNIPER (ALLIGATOR), 11 INS. IN DIAM., BEARS S 39-1/2° W, 37.4 LKS. DIST., MKD. X BT.
A JUNIPER (ALLIGATOR), 6 INS. IN DIAM., BEARS S 74° E, 55.1 LKS. DIST., MKD. X BT.

NORTH ONE QUARTER
A STANDARD GLO IRON POST, 1 IN. IN DIAM., PROTRUDING 20 INS. ABOVE THE GROUND, IN A MOUND OF STONE, WITH BRASS CAP MKD:

FROM WHICH
A JUNIPER (ALLIGATOR), 17 INS. IN DIAM., BEARS S22-1/2° W, 17.6 LKS. DIST. MKD. X BT.
A JUNIPER (ALLIGATOR), 10 INS. IN DIAM., BEARS N46° W, 49.7 LKS. DIST., MKD. X BT.

C 1/4
SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 4 INS. IN THE GROUND, ENCIrcLED BY A MOUND OF STONE, 36 INS. BASE TO TOP OF ALUMINUM CAP.

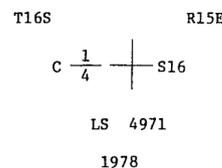

FROM WHICH
A JUNIPER, 9 INS. IN DIAM., BEARS S 30° E, 81 LKS. DIST. (RECORD) MKD. 1/4 S16 BT.
EVIDENCE OF SCRIBING BEARS N 10° W, 59 LKS. DIST. MKD. 1/4 S9 BT.


STATE OF NEW MEXICO } ss.
OTERO COUNTY }
FILED FOR RECORD IN MY OFFICE
This 31 day of October 1978
At 11:05 o'clock A.M. and duly recorded
in Book No. 23 Page 45 of
the records of Otero County, New Mexico
Margaret D. Sanchez
County Clerk, Otero County, New Mexico
By M. Adams Deput
37661



A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19 SITUATED IN T. 16 S., R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

NW 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 17 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 24 INS. BASE TO TOP OF ALUMINUM CAP.

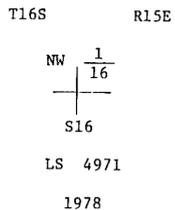

FROM WHICH A JUNIPER (ALLIGATOR), 34 INS. IN DIAM., BEARS N 51° W, 23.6 LKS. DIST., MKD. X BT. A JUNIPER (ALLIGATOR), 26 INS. IN DIAM., BEARS N 02-1/4° W, 120.2 LKS. DIST., MKD. X BT.


SECTION 17, T16S, R15E, NMPM

WEST ONE QUARTER

NOT FOUND

NORTHWEST CORNER


A STANDARD GLO IRON POST, PROTRUDING 5 INS. ABOVE SMALL MOUND OF STONE, ALONGSIDE ORIGINAL CORNER STONE, WITH BRASS CAP MKD.

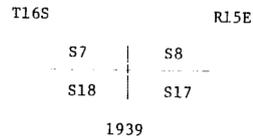

FROM WHICH A JUNIPER, 7 INS. IN DIAM., BEARS N 55° E, 100 LKS. DIST. BLAZE CLOSED. A JUNIPER, 12 INS. IN DIAM., BEARS S 67° E, 159 LKS. DIST., MKD. R15E S17 BT. A YELLOW PINE SNAG, DOWN AND DEAD, BEARS S 11° W, 190 LKS. DIST. NO MARKINGS VISIBLE. A CEDAR, 12 INS. IN DIAM., BEARS N 48° W, 135 LKS. DIST., MKD. T16S R15E S7 BT.

NORTH ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 24 INS. ABOVE THE GROUND, FIRMLY SET IN A MOUND OF STONE, WITH BRASS CAP MKD.



FROM WHICH A JUNIPER, 12 INS. IN DIAM., BEARS S 30° E, 53 LKS. DIST. (RECORD) MKD. 1/4 S17 BT.

NORTHEAST CORNER


SEE NORTHWEST CORNER OF SECTION 16.

EAST ONE QUARTER

SEE WEST ONE QUARTER OF SECTION 16.

CORNERS ESTABLISHED BY THIS SURVEY

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 6 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 36 INS. BASE TO TOP OF ALUMINUM CAP.

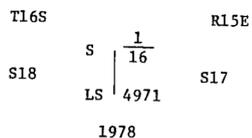


FROM WHICH

A PINON, 8 INS. IN DIAM., BEARS N 20-3/4° E, 41.2 LKS. DIST., MKD. X BT. A JUNIPER (ONE SEEDED), 7 INS. IN DIAM., BEARS S 44° E, 28.8 LKS. DIST., MKD. X BT.

1/4 WITNESS CORNER


FOUND ORIGINAL IRON PIPE BENT OVER WITH CAP MISSING. AT SAME POINT, SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 24 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 18 INS. BASE TO TOP OF ALUMINUM CAP.



ORIGINAL IRON PIPE SET BESIDE NEWLY SET CORNER. CORNER FALLS AT EDGE OF ORCHARD AND STATE HIGHWAY RIGHT OF WAY. NO BEARING TREES WERE MARKED.

1/4


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 25-1/2 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 18 INS. BASE TO TOP OF ALUMINUM CAP.

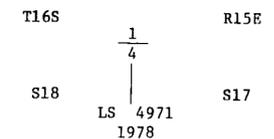

CORNER FALLS IN AN ORCHARD. NO TREES SUITABLE FOR MARKING AS BEARING TREES WITHIN LIMITS.

N 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 3 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 60 INS. BASE TO TOP OF ALUMINUM CAP.

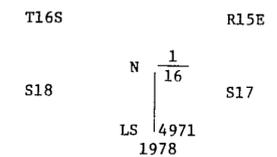

FROM WHICH A JUNIPER (ALLIGATOR), 9 INS. IN DIAM., BEARS S 61-1/2° W, 54.9 LKS. DIST., MKD. X BT. A JUNIPER (ALLIGATOR), 8 INS. IN DIAM., BEARS N 02° E, 10.8 LKS. DIST., MKD. X BT.

C 1/4

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 23 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 12 INS. BASE TO TOP OF ALUMINUM CAP.

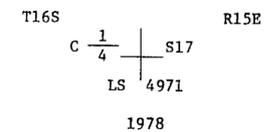

FROM WHICH A JUNIPER (ALLIGATOR), 14 INS. IN DIAM., BEARS S 18-1/2° W, 54 LKS. DIST. MKD. X BT. A JUNIPER (ALLIGATOR), 12 INS. IN DIAM., BEARS S 45-1/2° E, 80.9 LKS. DIST., MKD. X BT.

SOUTHEAST CORNER

SEE SOUTHWEST CORNER OF SECTION 16.

SOUTH ONE QUARTER


A STANDARD GLO IRON POST, PROTRUDING 24 INS. ABOVE THE GROUND, IN A MOUND OF STONE, WITH BRASS CAP MKD.



FROM WHICH A PINON, DEAD AND DOWN, 10 INS. IN DIAM., BEARS S 19° W, 82 LKS. DIST., (RECORD) MKD. 1/4 S20 BT. A PINON, STANDING AND DEAD, 7 INS. IN DIAM., BEARS N 76° W, 59 LKS. DIST., (RECORD) MKD. 1/4 S17 BT.

SOUTHWEST CORNER

A STANDARD GLO IRON POST, PROTRUDING 20 INS. ABOVE THE GROUND, IN A LARGE MOUND OF STONE, FIRMLY SET WITH BRASS CAP MKD.

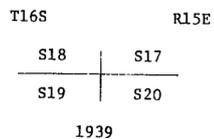

FROM WHICH A JUNIPER, 12 INS. IN DIAM., BEARS S 67° E, 121 LKS. DIST., (RECORD) BLAZE IS VISIBLE BUT NOT LEGIBLE. SEARCHED FOR OTHER BEARING TREES OF RECORD DIST. AND BEARINGS NONE FOUND.

STATE OF NEW MEXICO S 1/16 OTERO COUNTY SS. FILED FOR RECORD IN MY OFFICE This 21 day of October 1978 at 11:06 A.M. and duly recorded to Book No. 23 Page 43-45 of the records of Otero County, New Mexico County Clerk, Otero County, New Mexico Margaret D. Sanchez Deputy




SHEET 11 OF 13 BURKE/COLLINS/ASSOCIATES, P.C. CONSULTING ENGINEERS SURVEYORS ALAMOGORDO NEW MEXICO RUIDOSO CHECKED BY DTC DATE 09/78

A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19 SITUATED IN T. 16 S., R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

C-N 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 4 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 48 INS. BASE TO TOP OF ALUMINUM CAP.

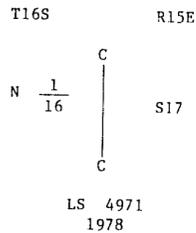

FROM WHICH A JUNIPER (ONE SEED), 9 INS. IN DIAM., BEARS N 72° W, 104.2 LKS. DIST., MKD. X BT. A JUNIPER (ALLIGATOR), 8 INS. IN DIAM., BEARS N 46-1/2° E, 110.5 LKS. DIST., MKD. X BT.


SECTION 18, T16S, R15E, NMPM

SOUTHEAST CORNER

SEE SOUTHWEST CORNER OF SECTION 17.

SOUTH ONE QUARTER


A STANDARD GLO IRON POST, PROTRUDING 15 INS. OUT OF THE GROUND, ENCIRCLED BY A MOUND OF STONE, 9 INS. TALL AND 36 INS. WIDE, FIRMLY SET, WITH BRASS CAP MKD.



FROM WHICH A YELLOW PINE STUMP, 12-1/2 INS. IN DIAM., BEARS N 19° E, (RECORD) 25 LKS. DIST. (RECORD) MKD. 1/4 S18 BT. (36 INS. TALL). NO EVIDENCE OF BEARING TREE AT RECORD BEARING S 51° E, 53 LKS. DIST.

SOUTHWEST CORNER

A STANDARD GLO IRON POST, PROTRUDING 6 INS. OUT OF THE GROUND, WITH SCATTERED MOUND OF STONE, FIRMLY SET, WITH BRASS CAP MKD.

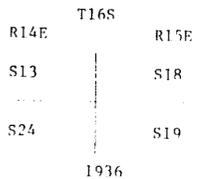

FROM WHICH A JUNIPER, 15 INS. IN DIAM., BEARS N 31° E, (RECORD) 61 LKS. DIST. (RECORD) BLAZE CLOSED. A JUNIPER, 17 INS. IN DIAM., BEARS N 65° W, (RECORD) 84 LKS. DIST. (RECORD) MKD. T16S, R14E, S13 BT.

STATE OF NEW MEXICO } ss. OTERO COUNTY } FILED FOR RECORD IN MY OFFICE This 31 day of October 1978 At 11:05 o'clock A.M. and duly recorded in Book No. 23 Page 33-45 of the records of Otero County, New Mexico Margaret D. Sanchez County Clerk, Otero County, New Mexico G. M. Robins Deputy

WEST ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 30 INS. ABOVE THE GROUND, FIRMLY SET IN A MOUND OF STONE 25 INS. HIGH, 60 INS. AT THE BASE WITH BRASS CAP MKD.



FROM WHICH A PINON, 10 INS. IN DIAM., BEARS N 65° E, 96 LKS. DIST. (RECORD BEARING AND DIST.). MARKED 1/4 S18 BT. NO EVIDENCE OF BT AT RECORD BEARING AND DIST. (S17-1/4° W, 84 LKS. DIST.).

NORTH ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 29 INS. OUT OF THE GROUND, LOOSELY SET IN A MOUND OF STONE, 26 INS. TALL AND 32 INS. WIDE.



FROM WHICH A JUNIPER SNAG, 8-1/2 INS. IN DIAM., BEARS N 5° E, (RECORD) 71 LKS. DIST. (RECORD). MKD. 1/4 S7 BT. A JUNIPER SNAG, 7-1/2 INS. IN DIAM., BEARS S 55° E, (RECORD) 50 LKS. DIST. (RECORD) MKD. 1/4 S18 BT.

NORTHEAST CORNER

SEE NORTHWEST CORNER OF SECTION 17.


EAST ONE QUARTER

SEE WEST ONE QUARTER OF SECTION 17.

CORNERS ESTABLISHED BY THIS SURVEY

C 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 15 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 42 INS. BASE TO TOP OF ALUMINUM CAP.

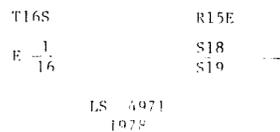

FROM WHICH A JUNIPER (ALLIGATOR), 10 INS. IN DIAM., BEARS N 57-1/4° W, 44.2 LKS. DIST. MKD. X BT. A PINON, 5 INS. IN DIAM., BEARS S 12-3/4° W, 66.2 LKS. DIST. MKD. X BT.

C 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 16 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 26 INS. BASE TO TOP OF ALUMINUM CAP.

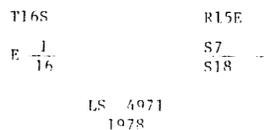

FROM WHICH A JUNIPER (ALLIGATOR), 7 INS. IN DIAM., BEARS N 18-1/4° W, 39.8 LKS. DIST. MKD. X BT. A JUNIPER (ALLIGATOR), 8 INS. IN DIAM., BEARS S 68-1/4° E, 62.5 LKS. DIST. MKD. X BT.

C-S 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 10 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 31 INS. BASE TO TOP OF ALUMINUM CAP.

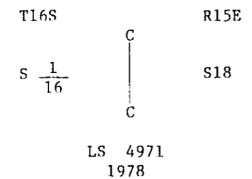

FROM WHICH A FENCE POST, 6 INS. IN DIAM., BEARS N 46-1/4° E, 34.2 LKS. A FENCE POST, 7 INS. IN DIAM., BEARS N 71-3/4° W, 87.4 LKS.

C 1/4


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 12 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 27 INS. BASE TO TOP OF ALUMINUM CAP.



FROM WHICH A JUNIPER (ALLIGATOR), 6 INS. IN DIAM., BEARS N 45-1/2° W, 23.9 LKS. DIST. MKD. X BT. A JUNIPER (ALLIGATOR), 13 INS. IN DIAM., BEARS S 54-1/2° W, 45.5 LKS. DIST. MKD. X BT.

C-N 1/16


SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 11 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 26 INS. BASE TO TOP OF ALUMINUM CAP.

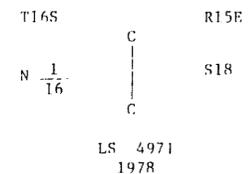

FROM WHICH A JUNIPER (ALLIGATOR), 9 INS. IN DIAM., BEARS N 49-1/4° W, 80.7 LKS. DIST. MKD. X BT. A JUNIPER (ALLIGATOR), 14 INS. IN DIAM., BEARS S 5-1/2° W, 68.4 LKS. DIST. MKD. X BT.

C-E 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 24 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 18 INS. BASE TO TOP OF ALUMINUM CAP.

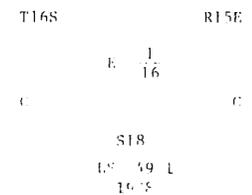

FROM WHICH A JUNIPER (ALLIGATOR), 14 INS. IN DIAM., BEARS S 4-3/4° E, 34.7 LKS. DIST. MKD. X BT. A PINON, 6 INS. IN DIAM., BEARS S 53-1/4° W, 84.8 LKS. DIST. MKD. X BT.



BURKE/COLLINS / ASSOCIATES, PC CONSULTING ENGINEERS SURVEYORS

NEW MEXICO

CHECKED BY DATE DTC 09/78

A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE RESURVEY, SUBDIVISION, AND MONUMENTATION OF SECTIONS 10, 11, 13, 14, 15, 16, 17, 18 & 19 SITUATED IN T. 16 S., R. 15 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

SE 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 16 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 24 INS. BASE TO TOP OF ALUMINUM CAP.

T16S R15E SE 1/16 S18 LS 4971 1978

FROM WHICH A PINON, 9 INS. IN DIAM., BEARS S 56° W, 36.7 LKS. DIST. MKD. X BT. A PINON, 7 INS. IN DIAM., BEARS S 77° E, 44.3 LKS. DIST. MKD. X BT.

NORTH ONE SIXTEENTH

A STANDARD GLO IRON POST, PROTRUDING 12 INS. ABOVE THE GROUND, ENCIRCLED BY A MOUND OF STONE, 30 INS. BASE WITH BRASS CAP MKD.

N 1/16 S24 S19 1936

FROM WHICH A PINE (PONDEROSA), 15 INS. IN DIAM., BEARS N 83° W, 86 LKS. DIST. A PINON, 11 INS. IN DIAM., BEARS N 51° E, 18 LKS.

C-N 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 10 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 42 INS. BASE TO TOP OF ALUMINUM CAP.

T16S R15E C N 1/16 S19 LS 4971 1978

FROM WHICH A PINE (PONDEROSA), 7 INS. IN DIAM., BEARS S 54-1/4° W, 20.7 LKS. DIST. MKD. X BT. A PINE (PONDEROSA), 14 INS. IN DIAM., BEARS S 32-1/4° E, 16.4 LKS. DIST., MKD. X BT.

NE 1/16

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 9 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 34 INS. BASE TO TOP OF ALUMINUM CAP.

T16S R15E NE 1/16 S18 LS 4971 1978

FROM WHICH A JUNIPER (ALLIGATOR), 5 INS. IN DIAM., BEARS S 69° W, 37.9 LKS. DIST. MKD. X BT. A JUNIPER (ALLIGATOR), 7 INS. IN DIAM., BEARS S 11-3/4° E, 56.3 LKS. DIST. MKD. X BT.

NORTHWEST CORNER

SEE SOUTHWEST CORNER OF SECTION 18.

NORTH ONE QUARTER

SEE SOUTH ONE QUARTER OF SECTION 18.

NORTHEAST CORNER

SEE SOUTHWEST CORNER OF SECTION 17.

EAST ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 14 INS. ABOVE THE GROUND, FIRMLY SET IN A MOUND OF STONE, 24 INS. AT THE BASE AND 10 INS. ABOVE THE GROUND, WITH BRASS CAP MKD.

1/4 S19 S20 1939

FROM WHICH A PINON, 10 INS. IN DIAM., BEARS N 40° E, 36 LKS. DIST. BLAZE CLOSED. A YELLOW PINE, DEAD AND DOWN, BEARS 86° W, 57 LKS. DIST.

CORNERS ESTABLISHED BY THIS SURVEY

SET AN ALUMINUM POST, 30 INS. LONG, 2-1/2 INS. IN DIAM., 10 INS. IN THE GROUND, ENCIRCLED BY A MOUND OF STONE, 36 INS. BASE TO TOP OF ALUMINUM CAP.

T16S R15E C 1/4 S19 LS 4971 1978

FROM WHICH A PINON, 5 INS. IN DIAM., BEARS N 63° W, 30.7 LKS. DIST. MKD. X BT. A PINON, 6 INS. IN DIAM., BEARS N 52° E, 37.9 LKS. DIST. MKD. X BT.

SOUTH ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 12 INS. ABOVE THE GROUND, FIRMLY SET IN A SCATTERED MOUND OF STONE, WITH BRASS CAP MKD.

1/4 S19 S30 1939

FROM WHICH A JUNIPER, DEAD AND DOWN, 10 INS. IN DIAM., BEARS N 43° E, (RECORD) N 45° E, 54 LKS. DIST. (RECORD) MKD. 1/4 S19 BT. A JUNIPER, 16 INS. IN DIAM., BEARS S 29° E, 41 LKS. DIST. (RECORD BEARING & DIST.). BLAZE CLOSED.

C 1/4

WEST ONE QUARTER

A STANDARD GLO IRON POST, PROTRUDING 4 INS. ABOVE THE GROUND, IN A SMALL MOUND OF ROCK WITH BRASS CAP MKD.

1/4 S24 S19 1936

FROM WHICH A PINE, DEAD AND DOWN, 18 INS. IN DIAM., BEARS N 50° E, 285 LKS. DIST. (RECORD) MKD. 1/4 S19 BT. A PINE, 12 INS. IN DIAM., BEARS N 76° W, 137 LKS. DIST. (RECORD). BLAZE CLOSED.

STATE OF NEW MEXICO } ss. OTERO COUNTY } FILED FOR RECORD IN MY OFFICE 31 day of October 1978 At 11:05 o'clock P.M. and duly recorded in Book No. 23 Page 23-45 of the records of Otero County, New Mexico Margaret O. Sanchez County Clerk, Otero County, New Mexico



BURKE / COLLINS / ASSOCIATES, PC CONSULTING ENGINEERS SURVEYORS ALAMOGORDO NEW MEXICO CHECKED BY DTC DATE 09/78