

PLAT OF THE RETRACEMENT AND REMONUMENTATION OF H.E.S.-207, SECTION 9 A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE

SITUATED IN T. 17 S., R. 11 E., NEW MEXICO PRINCIPAL MERIDIAN, NEW MEXICO

CERTIFICATION

This plat represents a record of the retracement and remonumentation of H.E.S.-207 located in Section 9, T17S, R11E, New Mexico Principal Meridian, which constitutes a portion of the property boundary of the Lincoln National Forest.

The original survey of H.E.S.-207 was made by C.A. Long, U.S. Forest Service Surveyor, in September 1915 and is a record of the Bureau of Land Management in Santa Fe, New Mexico.

This retracement, remonumentation and record thereof is for the purpose of identifying and perpetuating the evidence of the original survey, and was prepared as a result of the request of the Supervisor, Lincoln National Forest, and is intended for his exclusive use.

I certify that this retracement, remonumentation and record thereof was prepared by me or my assistants under my supervisory direction, and that same is true and correct to the best of my knowledge.

Survey completed July 17, 1978.

W.E. Roeder, Land Surveyors, Lincoln National Forest
 Alamogordo, New Mexico
 July 17, 1978

Assistants: R. Moya
 J. R. Kendall

Instrumentman



SEC. 9

TRANSCRIPT OF FIELD NOTES BOOK 17

Retracement and remonumentation of H.E.S.-207 located in Section 9, T17S, R11E, NMPM. Otero County, New Mexico

- NOTE: Forest Service Sign Designation
 54-2 Property Boundary
 54-3 Bearing Tree
 54-9 Survey Monument

I commence this survey at Corner No. 2 which is evidenced by the original bearing trees. Find no traces of the monument and believed to have been destroyed in the construction of a cattleguard. Intersect the record distances from the bearing trees, at which point:

Set an aluminum post, 2 1/2 ins. diam., 30 ins. long, 26 ins. in the ground, with aluminum cap mkd.

T17S R11E
 CC HES
 2 207
 L.S. 4691
 1978

- From which the original bearing trees:
 A Ponderosa pine, 26 ins. diam., bears N80°45'E, 33 lks. dist. (record) with a partially closed blaze, markings visible. Attach Forest Service sign 54-3.
 An Alligator juniper, 40 ins. diam., bears S14°18'E, 140 lks. dist. (record) mkd. 2 HES + 207 B.T. Attach Forest Service sign 54-3.





The center of the East headwall of a concrete cattleguard bears N70°W, 18.5 lks. dist.

Drive a steel post with Forest Service sign 54-9 attached alongside of corner post.

Observe sun and determine bearing.

LEGEND

- CORNER REMONUMENTED/MONUMENTED.....●
- FOUND EVIDENCE BELIEVED ACCEPTABLE.....⊗
- BOUNDARY OF NATIONAL FOREST LAND.....—
- PORTION OF SURVEY NOT A FOREST SERVICE PROPERTY LINE.....—
- ORIGINAL SURVEY LINE NOT INCLUDED IN THIS SURVEY.....- - - - -

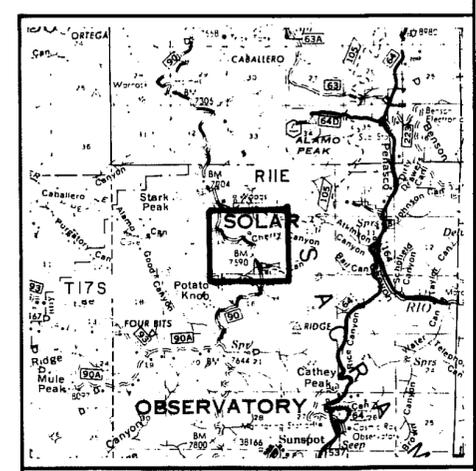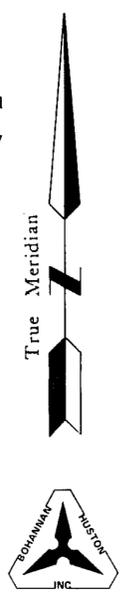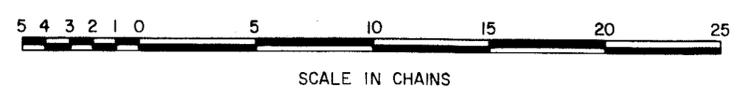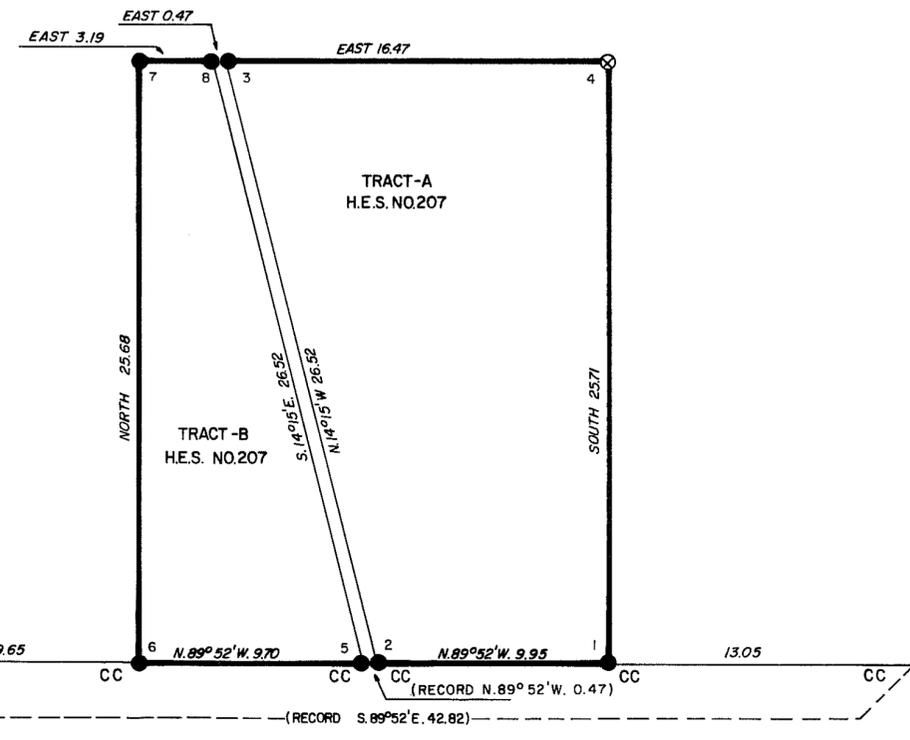

PLAT OF THE RETRACEMENT AND REMONUMENTATION OF H.E.S.-207, SECTION 9 A PORTION OF THE LINCOLN NATIONAL FOREST PROPERTY LINE

Thence;
00.00 N89°52'W (record bearing)
chains
0.47 (record distance)

Find no traces of the original monument, believed destroyed in construction of cattleguard.

Set an aluminum post 2½ ins. diam., 30 ins. long, top flush with ground, with aluminum cap mkd.

T17S R11E
HES \ CC
207 | 5
L.S. 4691
1978

From which an original bearing tree

An Oak, 12 ins. diam., almost dead, bears N88°50'W, 105 lks. dist. (record) mkd. 5 HES + 207 B.T.

Attach Forest Service sign 54-3.

Find no traces of other bearing tree.

Mark two new bearing trees.

A Ponderosa pine, 14 ins. diam., bears S49°W, 24 lks. dist., mkd. X B.T. Attach Forest Service sign 54-3.

A Ponderosa pine, 12 ins. diam., bears N33°W, 90 lks. dist., mkd. X B.T. Attach Forest Service sign 54-3.

The center of the West headwall of a concrete cattleguard bears N65°E, 6.0 lks. dist.

Thence;
00.00 N14°15'W (record bearing)
26.52 (record distance)

Find no traces of corner monument, believed destroyed in construction of cattleguard. At point for corner.

Set an aluminum post 2½ ins. diam., 30 ins. long, flush with ground in cattleguard by-pass road, with aluminum cap mkd.

T17S R11E
HES \ 8
207 |
L.S. 4691
1978

From which new bearing trees

A Ponderosa pine, 14 ins. diam., bears S81°E, 60 lks. mkd. X B.T.

Attach Forest Service sign 54-3

An Alligator juniper, 12 ins. diam., bears N26°E, 91 lks. dist., mkd. X B.T.

Attach Forest Service sign 54-3

The South end of the west headwall of a concrete cattleguard bears N40°E, 8.0 lks. dist.

Thence;
00.00 East (record bearing)
0.47 (record distance)

The point for Corner No. 3 which is evidenced by an original bearing tree

A Ponderosa pine, 24 ins. diam., dead and down, mkd. 3 HES + 207 B.T., place where tree stood bears N32°00'E, 122 lks. dist. (record). Attach Forest Service sign 54-3.

Find no traces of marked stone.

At point for Corner No. 3

Set an aluminum post 2½ ins. diam., 30 ins. long, 26 ins. in the ground, with aluminum cap mkd.

T17S R11E
3 |
HES
207
L.S. 4691
1978

From which a new bearing tree:

A Ponderosa pine, 14 ins. diam., bears S50°E, 16 lks. dist., mkd. X B.T. This tree is the same that was marked for Corner No. 8 previously described.

The South end of the East headwall of a concrete cattleguard bears N55°W, 22 lks. dist.

Drive a steel post with Forest Service sign 54-9 attached alongside of corner.

Return to Corner No. 8, previously described

Thence;
00.00 West (record bearing)
3.19 (record distance)

The point for Corner No. 7 which is evidenced by the remains of an original bearing tree

An Alligator juniper stump, 40 ins. diam., 10 ft. high, uprooted and fallen on its side, mkd. 7 HES + 207 B.T. Place where tree stood bears N41°45'W, 23 lks. dist.

Attach Forest Service sign 54-3 to stump

Find no traces of official corner monument. At point of corner,

Set an aluminum post, 2½ ins. diam., 30 ins. long, 24 ins. in the ground with an aluminum cap mkd.

T17S R11E
7 |
HES
207
L.S. 4691
1978

Mark two new bearing trees

A Ponderosa pine, 8 ins. diam., bears N89°W, 8½ lks. dist., mkd. X B.T.

A Ponderosa pine, 16 ins. diam., bears N31°E, 46 lks. dist., mkd. X B.T.

Attach Forest Service sign 54-3 to bearing trees

A fence corner bears N42°E, 27 lks. dist., from which a barbed wire fence extends East and South. At the fence corner find the list corner, a limestone 12x12x6 ins., mkd. 4. This corner was reported destroyed by C.A. Long, Forest Service Surveyor during his official survey on September 29, 1915.

Deposit the list corner alongside aluminum post.

Drive a steel post with Forest Service sign 54-2 and 54-9 attached alongside.

At Corner No. 1 recover a limestone meas. 12x3x20 ins. fallen on its side, mkd. HES 207 ¼ CC.

In place of mkd. stone.

Set an aluminum post, 2½ ins. diam., 30 ins. long, with aluminum cap mkd.

T17S R11E
HES | CC
207 |
1
L.S. 4691
1978

Bury the mkd. stone along East side of post.

From which the original bearing trees

An Alligator juniper, 30 ins. diam., bears N10°30'E, 88 lks. dist (record) mkd. 1 HES + 207 B.T.

A Ponderosa pine stump, 14 ins. diam., 10 ft. high, bears N85°52'W, 41 lks. dist. (record) mkd. 1 HES + 207 B.T.

Mark a new bearing tree

An alligator juniper, 14 ins. diam., bears N45°W, 55 lks. dist., mkd. X B.T.

Attach Forest Service signs 54-3 to all bearing trees.

Drive a steel post with Forest Service signs 54-2 and 54-4 attached east of corner.

At Corner No. 4 recover a limestone firmly set, projected 18x7x18 ins. above the ground, mkd. 4 HES 207 on Southwest face and a chiseled + on top.

No bearing trees established, none available.

A fence corner bears East, 7.5 lks. dist., from which a barbed wire fence extends West and South.

Drive a steel post with Forest Service signs 54-2 and 54-9 attached alongside of mkd. stone.

Corner is on a steep Southwest slope in dense brush.

At Corner No. 6 recover a limestone firmly set, projected 16x8x12 ins. above the ground, marked but not legible.

Alongside marked stone.

Set an aluminum post, 2½ ins. diam., 30 ins. long, with aluminum cap mkd.

T17S R11E
HES
CC |
207
6 |
L.S. 4691
1978

From which the original bearing trees

An Oak, 14 ins. diam., bears N79°30'E, 96 lks. dist., (record) with an overgrown blaze. An Oak stump, 12 ins. diam., 10 ft. high, bears N15°35'E, 40 lks. dist., (record) mkd. 6 HES + 207 B.T.

The remains of a Pine dead and down rotted and pieces scattered, find portion of trunk mkd. 6 HES + 207 B.T. Place where tree stood bears S5°40'W, 37 lks. dist., (record)

Mark a new bearing tree

A Douglas fir, 8 ins. diam., bears S17°30'W, 19 lks. dist., mkd. X B.T.

Attach Forest Service signs 54-3 to all bearing trees.

A fence corner bears North, 15 lks. dist., from which a barbed wire fence extends North and East.

Drive a steel post with Forest Service signs 54-2 and 54-9 attached alongside of aluminum post.

STATE OF NEW MEXICO }
OTERO COUNTY }
FILED FOR RECORD IN MY OFFICE
This day of Nov 1978
At 9:50 o'clock A.M. and duly recorded
in Book No. 23 Page 51-52
the records of Otero County, New Mexico.
Margaret A. Sweeney
County Clerk, Otero County, New Mexico
Robert L. ...

